

# Fresh SFW13C1P-B Split Air Conditioner

**Site:** Mbsmpro

**Date:** December 31, 2025 | **Author:** www.mbsmpro.com

**URL:** <https://mbsmpro.com/fresh-sfw13c1p-b-split-air-conditioner/>



## Fresh SFW13C1P-B Split Air Conditioner: Technical Label, Specifications, and Error 11.1 Guide

The Fresh SFW13C1P-B split air conditioner is a 1.5 HP cooling-only indoor unit designed for 220–240 V residential applications, with a cooling capacity around 12,000 BTU/h and R22 refrigerant. Its nameplate also references the diagnostic code **ERR 11.1**, which technicians commonly associate with serial communication faults between indoor and outdoor units on similar split systems.

---

### Nameplate data overview

The identification label on the Fresh SFW13C1P-B indoor unit groups the key electrical and operating data needed for installation, commissioning, and service.

- Model family: SFW13C series, 1.5 HP, cooling-only split air conditioner.
- Typical application: Small to medium rooms (about 12–18 m<sup>2</sup> depending on climate and insulation).
- Refrigerant: R22 on legacy units in this series, with specified maximum operating pressures for high and low sides.

### Fresh SFW13C1P-B basic specifications

Parameter	Typical value / range	Notes
Series / model	SFW13C / SFW13C1P-B	Smart digital wall-mounted split.

<b>Parameter</b>	<b>Typical value / range</b>	<b>Notes</b>
Type	Split air conditioner, indoor unit	Wall hi-wall design.
Nominal horsepower	1.5 HP	Residential/light-commercial class.
Cooling capacity	≈ 12,000 BTU/h	Catalog values for 1.5 HP Fresh SFW13C.
Function	Cooling only	No heat pump on this variant.
Refrigerant	R22	On older SFW13C inverter range.
Voltage	220–240 V	Single-phase supply.
Frequency	50 Hz	MEA / Africa grid standard.
Moisture protection	IP24 (indoor casing)	Splash-resistant enclosure category on label.
Sound pressure level indoor	≈ 39 dB(A)	Quiet residential operation.

---

## **Electrical and operating characteristics**

The label on the SFW13C1P-B provides detailed electrical data that help installers size breakers, cables, and protection devices correctly.

- Rated voltage 220–240 V, 50 Hz single-phase with electronic inverter control on associated outdoor units in the SIFW/SFW families.

- Rated and maximum currents are specified (often around 6–8 A running and 20–25 A max), guiding breaker choice and cable sizing.
- Input power on cooling is in the 1.5 kW class for a 1.5 HP Fresh split, which matches catalog data for SIFW13C-IP and SFW13C series.

### Indicative electrical table for 1.5 HP Fresh SFW13C series

Item	Typical value	Practical implication
Rated current (cooling)	≈ 6–7 A	Used to check running load.
Maximum current	≈ 25 A	Used for MCB / fuse rating margin.
Rated input power	≈ 1,560 W	Helps estimate energy consumption.
Isolation / protection	25 A marking, IP24	Indoor unit protection coordination.

---

## ERR 11.1 on Fresh SFW13C1P-B

The nameplate of this indoor unit explicitly lists **“ERR 11.1”**, indicating that self-diagnostic communication is part of the design.

- On many inverter split systems, **error 11 or 11.1 corresponds to a serial communication error between indoor and outdoor units** (loss or corruption of signal on the interconnecting terminals).
- Service manuals for comparable brands describe error 11 as forward or reverse transfer serial communication failure, often triggered when the outdoor PCB does not properly receive the indoor control signal for

10 seconds or more.

### Typical causes associated with error 11 / 11.1

Possible cause	Description	Reference behavior
Loose or oxidized interconnecting terminals	Poor contact on indoor-outdoor signal cable can interrupt data communication.	
Wrong wiring sequence	Reversed communication cores (e.g., terminals 2-3 swapped) lead to serial transfer errors.	
Damaged communication cable	Mechanical damage or moisture ingress causes intermittent signal loss.	
PCB failure	Indoor or outdoor main board cannot generate or read serial signal.	
External electrical noise	Strong interference, bad earthing or voltage dips disturb the serial bus.	

---

## Professional troubleshooting approach

Professional technicians treating a Fresh SFW13C1P-B that displays **ERR 11.1** can follow a methodical process inspired by standard inverter AC

service instructions.

### **1. Reset and verify supply**

- Isolate power for several minutes, then re-energize and confirm that error 11.1 reappears under normal load, ruling out a temporary voltage dip.
- Check mains voltage within 220–240 V and verify correct earthing to reduce electrical noise on the serial line.

### **2. Inspect communication wiring**

- Confirm that the communication terminals on indoor and outdoor units are tightened, corrosion-free, and wired in the manufacturer's order.
- Trace the cable path for cuts, joints, or water ingress, replacing suspect lengths with shielded cable where specified.

### **3. Measure serial signal**

- Service documentation for similar systems specifies that the AC serial signal between designated terminals should swing within an expected voltage window (for example, 30–130 V AC) during operation; abnormal readings indicate PCB or wiring faults.
- During measurement, verify that fan motors and relays do not induce excessive noise on the same harness.

### **4. Evaluate PCBs and external causes**

- When wiring and supply are correct, error 11.1 persisting usually points to indoor or outdoor controller PCB failure.
  - Before replacing boards, technicians should rule out external causes such as unstable power feeders, undersized generators, or nearby heavy electrical machinery.
-

## **User-oriented best practices**

End users operating a Fresh SFW13C1P-B split unit can reduce the risk of error codes and extend system life by following a few simple best practices derived from documentation of modern Fresh air conditioners.

- Maintain clean indoor filters to preserve airflow and reduce strain on the refrigeration circuit and electronics.
- Avoid repeatedly cycling power from the main breaker, as frequent restarts stress inverter components and communication circuits; instead use the remote control for routine on-off operations.
- If error 11.1 appears repeatedly after a full power reset, contact qualified HVAC service instead of attempting to rewire the communication cable.



[NL-J02.121.7Z-ASYG-KETA-Handleiding-Service-Instructions-ASYG-KETA](#)  
[Download](#)

## Latest Articles

- [Guide de Dépannage de la Carte Inverter : Climatiseur Kolin KSM-IW20WAE](#)
- [RCFF-2HP Capillary Tube for a Samsung 18000 BTU air conditioner](#)
- [Carbon brushes washing machine motors](#)
- [Chauffe-eau Junkers : Restauration d'un Classique](#)
- [WS57H Compressor, 1/6 hp, Capacitor Requirement 4mf](#)
- [Hisense inverter expert, installation](#)
- [Copeland D3DS5-100X 10 HP Freezer Compressor](#)

- Bitzer 6G-30.2Y: The High-Performance 30 HP Semi-Hermetic
- Réparer un chauffe-eau à gaz Olympic 6L
- Best piping practices for semi-hermetic systems
- Core ChauffeEau Junkers Mid-1980s to Late 1990s
- Not recommended R410A to R407c
- Details of refrigerant R134a
- The electrical circuit for a timer-based steam refrigerator is an interesting one
- Changing Filter 1/5 Hp
- 1/5 HP Compressor oil change: How much and how to do it right
- Deep cleaning AC units from A to Z... that's our craft
- Plumbing Fittings Explained
- Can the GL80 compressor be installed in place of the GL90?
- The process of replacing the air conditioner compressor is successful, and it is working as it was before ?